


September 2018

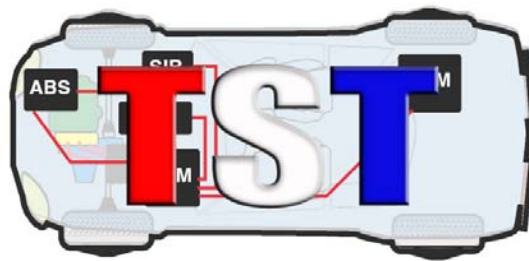

Technicians Service Training

INSIDE THIS ISSUE:

"TST Seminars and Big Event For 2018 & 2019"

P. 1

"How To Tackle Oil Consumption Issues"

P. 2 -26

Upcoming Seminars:
MA, CT, NJ & NY

October 22, 23, 24, 25

November 12, 13, 14, 15

Jan 7, 10, 11, 12 2019

TST BIG Event Saturday, March 30th, 2019

May 13, 14, 15, 16 2019

SAVE MONEY by signing up for Membership...

Seminars...\$50.00 or Simulcast \$30.00 member price

Check out our YouTube channel [tstseminars](#)

Like us Facebook

Editor "G" Jerry Truglia

© 2018 ATTS INC.

"TST Seminars and Big Event For 2018 & 2019"

The new season for seminars is upon us, starting this month and ending the season in May 2019. TST has a total of 6 seminars, 5 of which be held in four different states along with 5 simulcast seminars. We also have our 16th annual TST Big Event on Saturday March 30, 2019.

The list of instructors for this season are once again the top in the industry. This year starts off with Bob Augustine in September and rolls along with; Kris Lewis, Vince Manship, Brandon Stickler, John Thornton, Ken Zanders, Eric Ziegler, to name a few. **Members can save money by purchasing the package, bringing the seminar price down to \$50.00 for seminar and \$30.00 for simulcast.**

The TST Big Event can be purchased with the seminar package for \$100.00 if your membership is up to date. If you have not purchase a seminar package you can do so until the end of this month. A refund for the September's seminar will be refunded. Remember that the package saves you money! *This offer is only good until September 30th.*

No problem if you miss a seminar, since you will receive online access for one year along with the handout of the seminar and the TST newsletter.

Another benefit that is part of a TST membership is discounts on tools and equipment. Before you purchase any tools check with TST to see how much you can save.

"How To Tackle Oil Consumption Issues"

Have you noticed lately that some of your customers' engine oil levels are low even though the mileage interval has not been met? Well, you're not alone, since many OEs have been using thinner viscosity oil for their new engine designs to meet the CAFÉ (Corporate Average Fuel Economy) standards.

Before we go to deep into this subject, we need an understanding of the oil that is required in today's modern engine. For years, we looked at an oil bottle only taking notice of the name brand and oil weight to maybe decide on whether to use it in the engine we are working on. Those days are over, my friend, now there are recommendations called service ratings that classify passenger and commercial vehicle motor oils by the American Petroleum Institute (API). Your most likely familiar with the API donut (Figure 1) that is on every oil bottle that has the two letter rating of the oil. The letters that you need to look for currently are either SM or SN, and supersedes the previous ratings. The donut also has the Society of Automotive Engineers (SAE) viscosity grade that have the common numbers on the bottle such as 0W-20 or 5W-30 and so on.



Figure 1

By the way, the "W" after the first number does not stand for weight but rather for a "winter" designed oil. A 5-30 is not the same as a 5W-30 oil so be careful to use the specific recommended oil. Manufacturer requirements and specifications are listed in all the popular service information systems.

Another important thing to remember is the difference between gasoline and diesel engine requirements. The specification for the engines are different, and it is vital that the correct oil be used. Rather than the SN rated oil, diesel engines require the use of a CJ-4 oil. The C stands for commercial engines (diesel engines) and J is the current performance level while the 4 in a J-4 oil indicates a 4-stroke diesel engine. Believe it or not, there is still more to understand before we move on to some problem vehicles. The OE's require the correct oil, and in some cases the oil filter, to be installed in *(Con't on page 6)*

COVERAGE AT THE PRICE YOU NEED

3 RELIABLE

DIAGNOSTIC SERVICE TOOLS



ADVANCED
SERVICE FUNCTIONS+
ALL SYSTEMS DIAGNOSTICS

AFFORDABLE
SERVICE FUNCTIONS+
ALL SYSTEMS DIAGNOSTICS

COMPLETE
DIAGNOSTIC CODING & ADAPTATIONS+
ADVANCED SERVICE FUNCTIONS+
ALL SYSTEMS DIAGNOSTICS

MAXIMIZE BILLABLE LABOR HOURS, SHORTEN DIAGNOSTIC TIME AND COMPLETE REPAIRS FASTER WITH AUTEL SERVICE TOOLS.



MaxiCHECK MX808 7" IN SCREEN

SERVICE + SYSTEM DIAGNOSTICS

- Advanced Service Functions
- All Systems Diagnostics
- AutoVIN + AutoSCAN Detection
- MaxiSYS Suite Applications



MaxiDIAG MD808P

SERVICE + SYSTEM DIAGNOSTICS

- Affordable Service Functions
- All Systems Diagnostics
- AutoSCAN Detection
- FREE Lifetime Software Updates



MaxiSYS MS906TS 8" IN SCREEN

COMPLETE DIAGNOSTICS

- Bi-Directional Control
- Advanced Service Functions
- All Systems Diagnostics
- MaxiSYS Suite Applications



(855) 288-3587
maxitpms.com



autel.com
Register and update tools for latest coverage
©2017 Autel Intelligent Technology Inc.



AUTEL



FIX MORE CARS FASTER

OTC DIAGNOSTICS
DRIVEN BY BOSCH



PROFESSIONAL REPAIR AND COLLISION DIAGNOSTICS

- Quickly scans all modules and performs special tests and resets to diagnose and repair faster
- Includes one year of software updates for access to new tests, vehicle-ECU combinations and data items
- Wi-Fi enabled to wirelessly print, send and save reports for customers or insurers
- Evolve includes wiring diagrams for vehicles 1986 and newer and wireless, J2534-compliant VCI
- Newest 3.0 software includes more than 30 million likely repairs and troubleshooting tips
- Optional 3914 wireless battery and charger/starter system tester works with software version 2.10 and newer

What is TST?

TST is a group of dedicated technicians and instructors committed to the continuing education of our fellow technicians. We provide training seminars to technicians at a reasonable price. TST brings our members nationally known instructors and state of the art training.

Our Goal & Mission Statement

- **Keep our fellow technicians up to date with the latest technology.**
- **Provide training seminars for a reasonable price.**
- **Deliver information that the technician can use now.**
- **Keep technicians informed of information affecting our industry.**
- **Increase consumer awareness of what a good technician is.**

Why join TST?

TST membership includes special pricing on weekday night seminars and the occasional full Saturday seminar. With a **\$75.00** yearly membership, the seminars are only **\$50.00**. **TST seminars are NOT sales or product seminars.** The instructors that TST brings in are all "hands-on" industry experts with up to date, cutting edge knowledge that you can use in your shop the next day. That's 75 dollars for a seminar in which you are able to learn something useful, for fixing those tough jobs that we all see on a regular basis. Our instructors are masters at making the complex understandable. Membership also includes a newsletter full of real world technical articles, diagnostic case studies, and solutions to the kinds of problems you see in your bays each week.

The following are some of TST's regular instructors:

Bernie Thompson of ATS

John Thornton of Autotrain Inc.

Wayne Colonna of ATSG

Jorge Menchu the "Labscope Guru," AES Wave

John Anello of Auto Tech On Wheels

Mark Warren of World Pac / Motor Magazine

Bob Pattengale of Bosch

Peter Meier of Motor Age Magazine

Ken Zanders of Illinois Air Team

"G" Jerry Truglia of A.T.T.S. Inc.



Technicians Service Training

FROM AMERICA'S LARGEST INDEPENDENT TRAINING ORGANIZATION



Copyright © 2007 Technicians Service Training, All Rights Reserved

Technicians Service Training

11 Lupi Plaza

Mahopac, NY 10541

Phone: (845) 628-6928

Fax: (845) 628-9109

Email:

Info@tstseminars.org

TST on YouTube...type in tstseminars

No part of this newsletter may be reproduced, stored in a retrieval system, or transmitted, in any form by any means, electronic, mechanical, photocopying, recording, or otherwise, without prior written permission of the authors.

Information contained in this newsletter is intended for use by professional auto repair technicians familiar with approved vehicle repair procedures. The authors are not responsible for physical injury or property damage resulting from the incorrect application of information or procedures outlined in this volume.

Currently there are **TST chapters in Connecticut, Massachusetts, New Jersey, New York** and membership continues to grow. For more information you can call **TST** headquarters at:

(845) 628-6928

www.TSTseminars.org

“How To Tackle Oil Consumption Issues” (con’t from p. 2)

the engine before they will even think about running their oil consumption test. More on the test later in the article but for now let’s move on with a few more bits of important information. There are another bunch of letters that are on the oil bottle such as ILSAC (International Lubricant Standardization and Approval Committee) that is common on oils that are used in Asian vehicles, such as GF-5 that is now recommended. The next standard, ACEA (Association des Constructeurs Européens d’Automobiles), that is a specification that must be used if you are changing oil on any European engine. The ACEA is a performance/quality classification such as A3/A5 tests that are used in Europe. This standard for European engines is more stringent than the API and ILSAC standards. Be aware if there is an engine issue due to lubrication, the OE will take an oil sample and send it to a lab for testing. When the lab results comes back, it must indicate the correct viscosity along with the approved rated oil for the engine was used or no warranty bucks will be paid out. Don’t be left on the hook for an expensive engine repair job due to improper oil usage. It’s always better to purchase a good quality oil that has the correct specifications to prevent damage to today’s very expensive engines.

Consumption Causes

There are many issues with oil consumption on today’s engine whether it’s a leak due to poor engine breathing or sealing. Consumption can also be caused by poor engine design such as piston ring, piston or engine block design issues. Since the engines we are working on are not our father’s Oldsmobile design, the amount of oil usage is different than years ago. The amount of normal oil usage has drastically changed in the past five to ten years. ***(Con’t on page 7)***

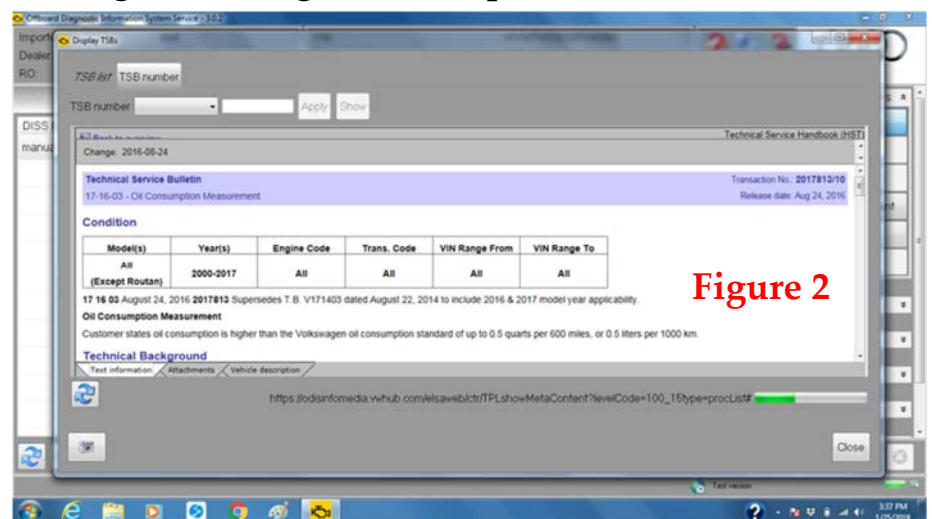


Figure 2

“How To Tackle Oil Consumption Issues” (con’t from p. 6)

For many years, the normal amount of oil consumption was considered to be a quart of oil every 3,000 to 4,000 miles after completing the engine break-in period.

This is not the case today as you can see by the ODIS VW factory scan tool screen shot (Figure 2) that states that up to 0.5 quart of oil in 600 miles is normal on VWs built from 2000 to 2017! Anyway, VW is not the only OE that has an oil consumption issue. GM, Toyota, Subaru, Honda are just a few that also have problems. We had one of our customers with a Subaru return to the dealer due to a high consumption and had a new motor installed for free under warranty. Many Camry hybrid owners, including one of ours, have received the complete engine assembly replacement along with catalytic converters for free. A Toyota TSB (Technical Service Bulletin) states that some 2006 to 2011 model year vehicles equipped with the 2AZ-FE engine may exhibit engine oil consumption issues and a P0300 DTC. The fix for this issue is the replacement of an updated piston assembly that has been changed to minimize oil consumption. Some other issues that I will cover in this article related to oil are the high failure rates of timing chains and related components. There have been studies conducted into the abnormal wear of timing chains, gears and the other components that has been linked to poor oil quality. The oil quality is a big factor in the accelerated wear of the previously mention components. Besides low oil quality, oil level, volume, pressure, viscosity, and the use of oils that don’t meet specifications, there are oil additives that can accelerate timing chain and component wear. The goal in this article is not to provide you with all the TSBs on oil consumption or timing chain problems since that would be redundant to information you can find in your shop’s service information system. With that said, you might want to search “oil consumption” next time you’re logged in!

Case Study Time

A 2009 Chevy Traverse 3.6L with a check engine light


(Con’t on page 10)

GTC505

Engine Ignition Analyzer



Complete ignition system diagnostic:

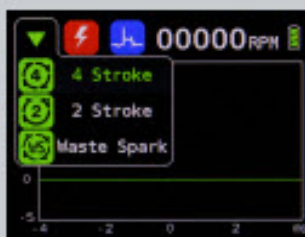

Works on 2 and 4 cycle, and waste spark ignition systems engines.




Displays secondary ignition waveforms.




Displays and measures spark burn (firing) time, dwell time, current ramp time, RPM, and spark plug peak voltage.



Candle stick graph compares maximum, minimum and average measurements of several cylinders.

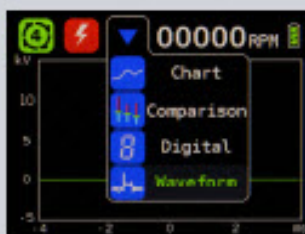

Selectable view of all measurements modes as chart, compare graph, analog gauge / digital readout and waveforms.

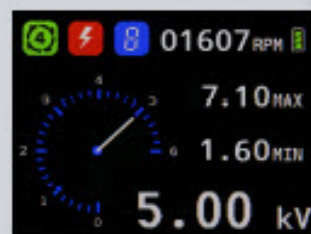

Analog gauge and digital readout with maximum and minimum.

Quick, powerful and easy to use

- Plug the appropriate sensor pick-up into the flexible probe
- Select the engine's cycle (4-stroke, 2-stroke, or waste spark)
- Select the measurement type and display format
- Place the pick-up on top of the ignition module, or over the spark plug wire
- The GTC505 will automatically detect and adjust all parameters to provide accurate measurements and clear graphs

Useful for troubleshooting:

- Non-starts
- Misfires
- Intermittent problems
- Primary and secondary coil circuits faults
- Fouled or damaged spark plugs
- Damaged spark plug wires



Specially designed pick-ups for coil on plug ignition modules (left) and spark plug wires (right).



Chart mode used for detecting intermittent or infrequent failures and misfires.



FEATURED PRODUCTS

A Family of Targeted G.D.I. Fuel System Products Offer solutions for your customer's G.D.I. deposit problems!

The Run-Rite® G.D.I. Fuel System Cleaning Kits contain products that were specifically formulated to address the unique needs of G.D.I. engines, while still providing the same high level cleaning required on P.F.I. engines. Safe for use on: Gasoline Direct Injection, Port Fuel Injection and Turbos & Inter-coolers. Recommended every 15,000 miles or annually. The G.D.I. Preventive Maintenance Kit is recommended in between annual services, every 7,500 miles, to maintain optimum G.D.I. engine performance.



Run-Rite® 2-Step G.D.I. Fuel System Cleaning Kit

Part #7017 12 kits/case

Contains one bottle G.D.I. Fuel System Cleaner and one can Direct Injection Deposit Cleaner.

Run-Rite® 3-Step G.D.I. Fuel System Cleaning Kit

Part #1077 8 kits/case

Contains one bottle G.D.I. Fuel System Cleaner, one can Direct Injection Deposit Cleaner and one bottle G.D.I. Oil System Treatment.

Run-Rite® G.D.I. Preventive Maintenance Kit

Part #1501 12 kits/case

Contains one bottle of Sledgehammer and a Fuel Shot.

BATTERY

Run-Rite® Battery Maintenance Kit

Part #6210 12 kits/case

- 2-step kit containing Battery Wash and Battery Corrosion Protectant



RE-INTRODUCING

iQ3 Performance Oil

Part #7300 12 bottles/case

- Engineered for higher performance, reduced emissions & increased fuel economy.
- 1 quart



1-800-872-8921

www.Run-Rite.com

“How To Tackle Oil Consumption Issues” (con’t from p. 7)

on, along with the following DTCs; P0017 (crankshaft position exhaust correlation Bank 1) (Figure 3), P0300, P0301, P0303 and P0306 came in. Since we know that this engine is known for engine related DTCs that are caused by timing chain issues we know what we have to check. Rather than spending time diagnosing ignition or fuel issues we are going to concentrate on the mechanical side. The 3.6L engine that is in our problem vehicle has known issues related to timing chain, gear and timing chain guides. In fact, GM will replace the damaged components at no charge up to 120K.

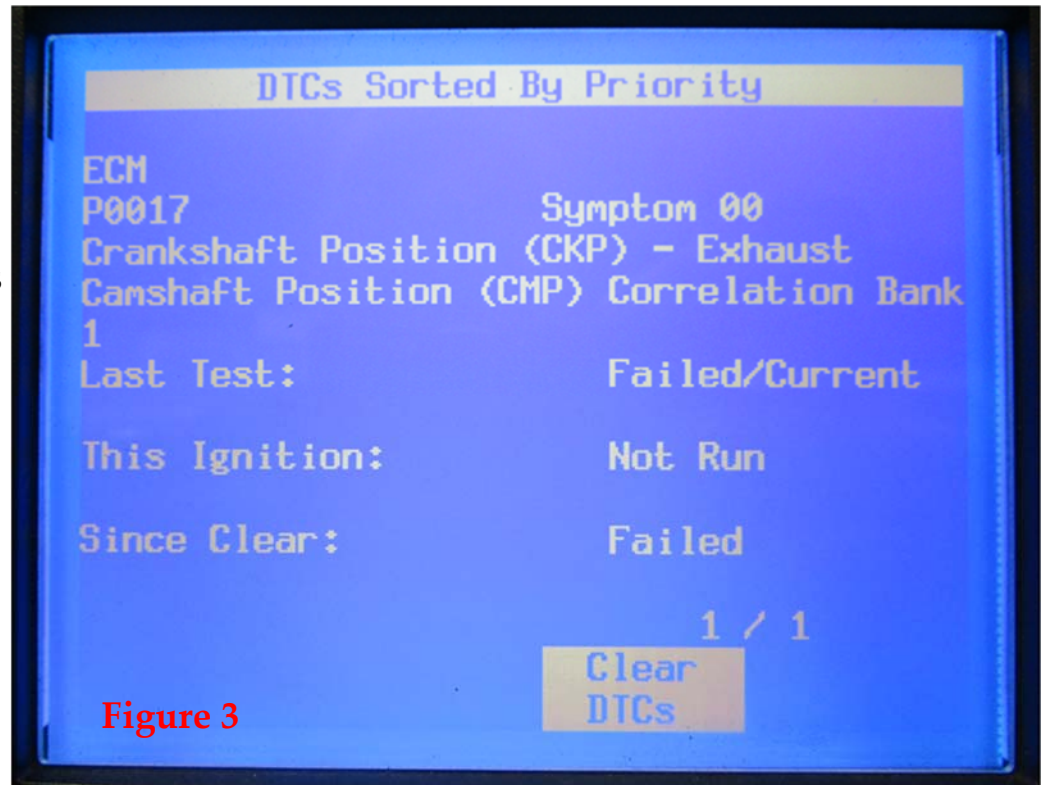


Figure 3

The GM dealer will replace the timing chains, inspect and only replace the gears and timing chain guides if there is extreme wear. Their research has uncovered a problem with timing chain stretch as being the main issue, so they no longer change all the components as they have done in the past. But hold on, the reason this engine has timing chain issues is due to oil and oil change intervals. GM had previously recommended a semi-synthetic DEXOS 5W-30 oil be used in the engine and changed at 7500 miles. Their new specification for oil is a full synthetic DEXOS 5W-30 that now has a shorter recommended oil change interval of 5000 miles. As you are surfing through service information, you will find that GM has a few TSBs that have references to timing chains and oil change requirements. Another tad bit of infor-

(Con't on page 11)

“How To Tackle Oil Consumption Issues” (con’t from p. 10)

The first thing that you should always check besides the oil level is the often overlooked PCV (Positive Crankcase Ventilation) system. Many times, the number one problem of oil consumption is oil being pulled through the PCV system. Make sure that the PCV valve and all the passages are clear of obstructions, along with using the OE PCV valve to avoid oil consumption problems. Any PCV restriction can cause oil consumption issues along with oil leaks from gaskets and seals.

Since the PCV and the passages were operating as designed, our first step in diagnosing the DTCs was to check the PID for camshaft degrees. We used the scan tool data to compare actual cam degrees compared to the desired

(Figure 4) of both Bank 1 and Bank 2. Notice from the screen shot in Figure 2

that Bank 1 was ok at the time, while Bank 2 was displaying 1 degree. Since Bank 2 was currently only displaying a small amount off the desired PID there must be an issue at different times related to engine speed and load. The same had to be true of the reading on Bank 1 since it was showing the exact degree of the desired PID. Obviously there had to be a bigger degree

difference from actual to desired to set the DTCs but the scan tool was not currently displaying the difference. With Bank 2 one degree off it most likely did not go far enough out of specifications or it would have set a P0018 or P0019 Bank 2 Intake and Exhaust Correlation DTCs. The scan tool data indicates an issue that leads to the random and cylinder number 6 misfire DTCs.

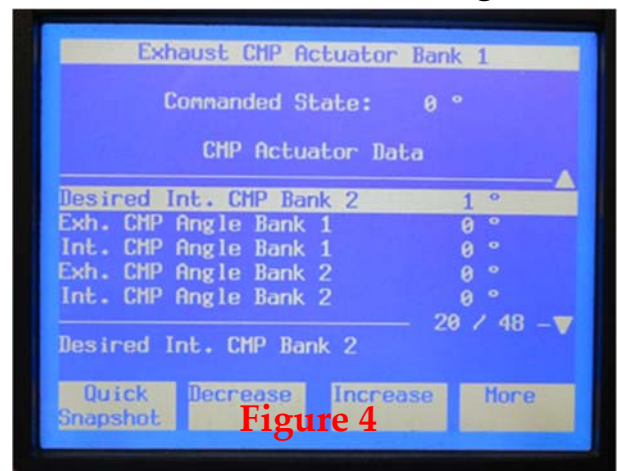


Figure 4

To uncover the root cause of the DTCs we decided to use the scan tool's bi-directional control to check the cam phaser solenoids. As we were commanding the phasers, we observed the actual to desired readings to see if oil had the ability to flow to the cam phasers. Since we did not see the expected difference in the actual to desired readings, it was time to con-

(Con't on page 14)

Are you ready for R-1234yf?



We are!



Neutronics
Refrigerant Analysis

1 (610) 524 - 8800

www.refrigerantid.com

Eliminate Uncertainty With Your **ULTIMATE REPAIR RESOURCE**



RAP
REMOTE ASSIST PROGRAM



AssistPlus

With trusted support from
Drew Technologies and Autologic
FIX IT ONCE



DREW TECHNOLOGIES
AN DRIS COMPANY

844.REFLASH (844.733.5274) DrewTech.com

©2018 Drew Technologies, Inc. Patent(s) pending. ©2018 Autologic.



AUTOLOGIC
AN DRIS COMPANY



844.235.4253

us.autologic.com



"How To Tackle Oil Consumption Issues" (con't from p. 11)

-nect our labscope to check the cam to crank sync. We needed to use four channels of the labscope so we could connect to the intake and exhaust cam sensors. Knowing where to put it is an important step, so Bill, my lead tech, located the PCM that was right up front on the left side of the radiator support. After looking at the wiring diagrams, Bill found both intake and exhaust camshaft position sensors and back probed them.

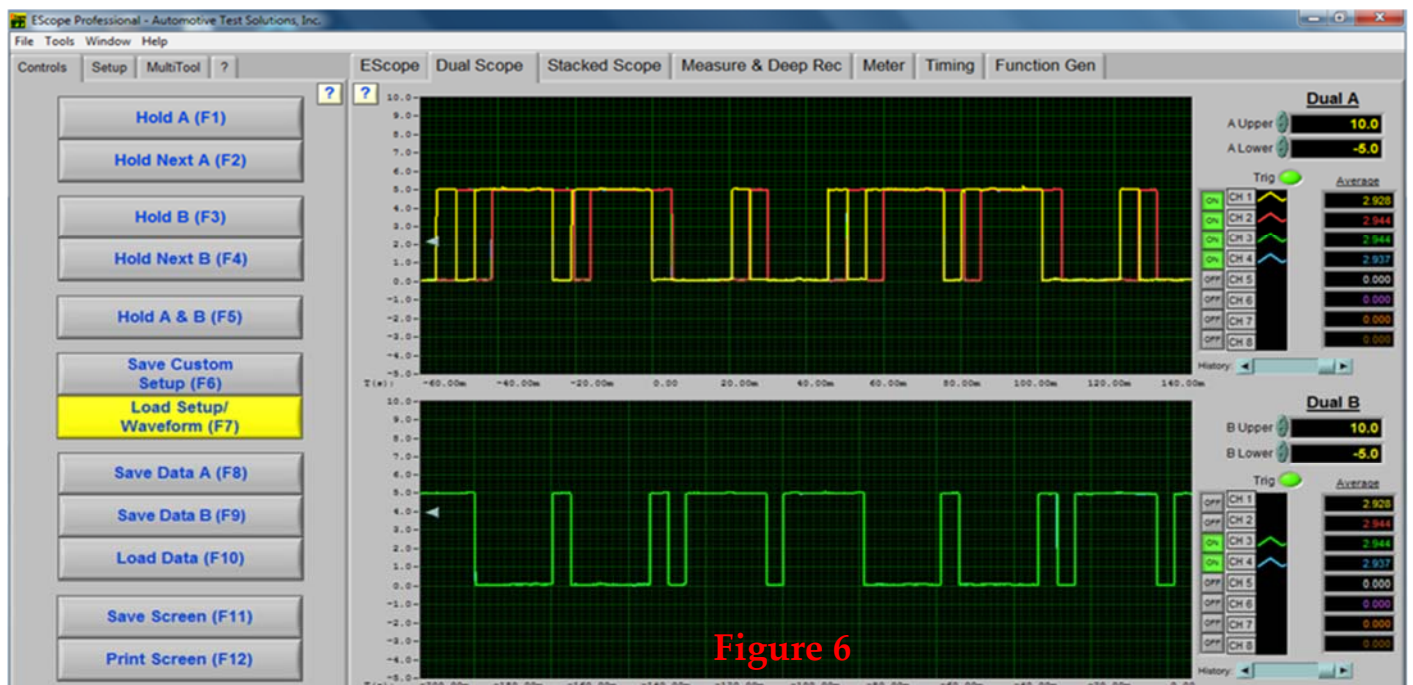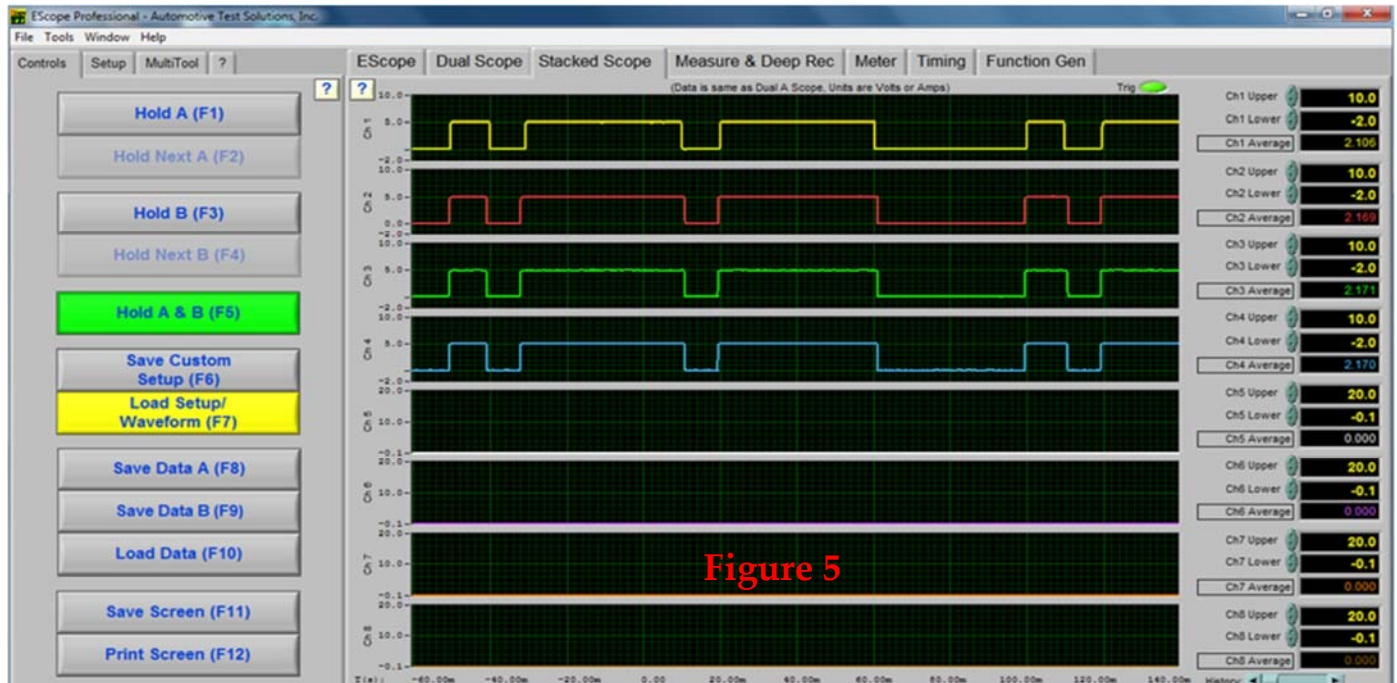

(Con't on page 20)

GO WITH THE **FLO!**

FLO- **DYNAMICS®**

**THE LEADER IN FLUID
MAINTENANCE EQUIPMENT**



BRAKE



TRANSMISSION



A/C




DIFFERENTIAL



**POWER
STEERING**



COOLANT

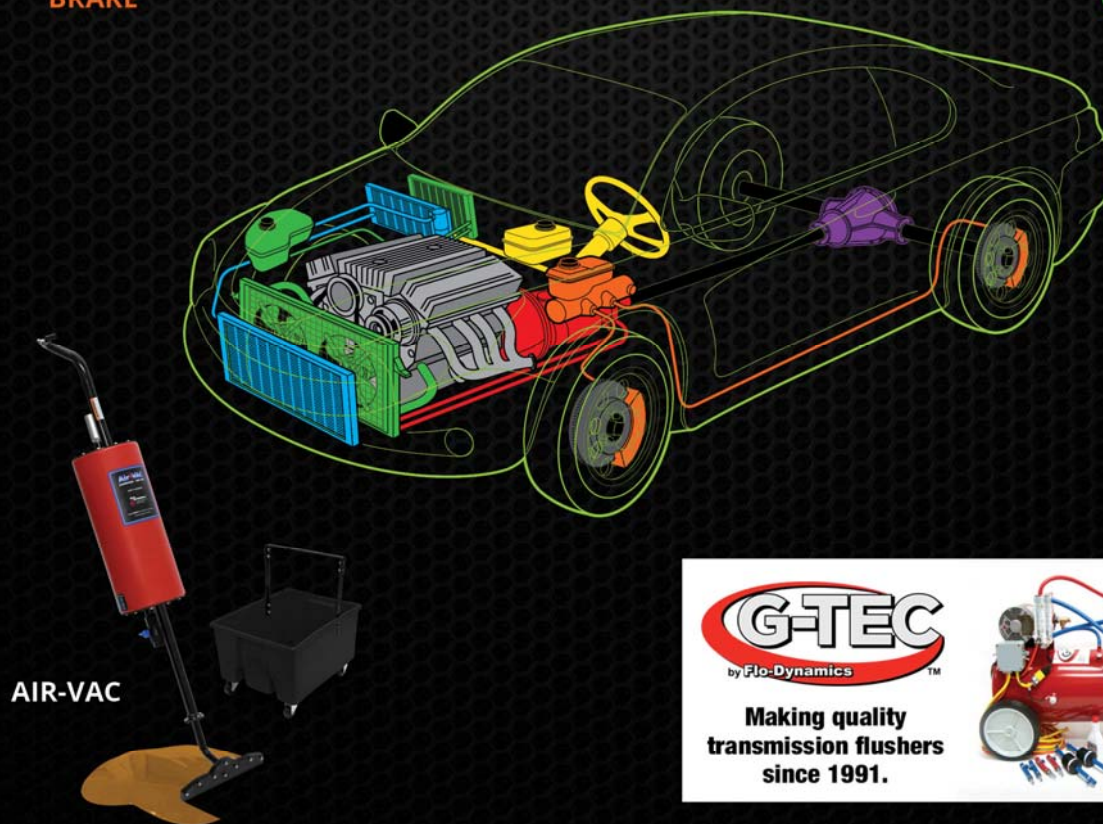

AIR-VAC



**Making quality
transmission flushers
since 1991.**





INTERNATIONAL AUTOMOTIVE TECHNICIANS NETWORK

WHERE THE PROFESSIONALS GO FOR
ADVICE ON TOUGH TO SOLVE JOBS

**MORE THAN
80,000 MEMBERS**

**FROM OVER
170 COUNTRIES**

**SHARING A COMBINED
2 MILLION YEARS OF EXPERIENCE**

WWW.IATN.NET

THE FUTURE IS NOW!

**PREMIUM PREVENTATIVE
MAINTENANCE PRODUCTS**



**GDI
Fuel and Air
Differential
Transfer Case
Power Steering
Automatic Transmission/CVT**

**Brake
Coolant
Battery Service
Climate Control
Diesel Injection
DPF Maintenance**

Lifetime
BG Protection Plan

 **Lubri-Care.com**

203-877-5690

LAUNCH
TECH USA
CREATE • CHANGE

X-431 Torque



- 431 Torque

"EXPERIENCE THE EASE"
"FEEL THE POWER"

WWW.LAUNCHTECHUSA.COM

1820 S. MILLIKEN AVE • ONTARIO, CA 91761 • PH : 1-877-528-6249



At AE Tools & Computers we help the aftermarket repair facility do everything the OEM dealer can do with regards to diagnostics. We give them the ability to keep their customer's vehicles in their bays through completion of the repair. This generally starts with a phone consultation to determine the TRUE needs of the individual repair facility. We do not want to just sell another tool. We want to sell the tool that meets the needs of the repair shop that we are servicing. **We are selling Solutions.**

YOU'VE GOT TECH SUPPORT

Simply call us when you have questions or problems. We will log in remotely to help you through the issues you are having. This support is REAL. This is not cable replacement support. Anyone can do that. We are actually helping you with the things that get the lights to go out on the dash, so you can deliver the car to the customer, get paid and move on to the next job.

HAVE QUESTIONS? **TALK TO A REAL PERSON!**

913.856.6678

SUPPORT@AETOOLS.US

LIVE SUPPORT HOURS **MONDAY - FRIDAY 8 AM - 6 PM CST**

WWW.AETOOLS.US

WHAT MAKES OUR LAPTOPS SO SPECIAL?



“How To Tackle Oil Consumption Issues” (con’t from p. 14)

With the labscope connected we were able to view the waveforms (Figures 5 and 6 on page 14) to see if the timing was off. Without a known good reference, it was difficult to tell if the waveforms were good or bad. We checked iATN and other internet sites for a good reference only to come up empty handed. Bill proceeded to do a bit more research and found a group of techs on Facebook that have a wavefile forum. The techs on the forum had a reference on what should be normal. We continued to check the camshaft waveforms as we commanded the phasers to check for proper movement and reference point. Our conclusion was that the timing chains were stretched, or the gears and guides were worn and needed replacement. Credit to Bill for doing good research, finding that GM would perform the repair for free up to 120K. With the information that Bill uncovered, it spurred me to a call the GM dealer that I have purchased a few vehicles from. I asked if they could check the vehicle out and get the job done within the next few weeks. Since this is a big dealership with over 40-plus bays and technicians, they had my customer drop his vehicle off the next day. The dealership told me that they have one technician that just does these timing chain jobs and that he had just finished one and was ready for another. We were surprised the job was completed that

quickly since this is not an easy job. The only way to properly perform this repair is to drop the subframe along with the complete power-train.

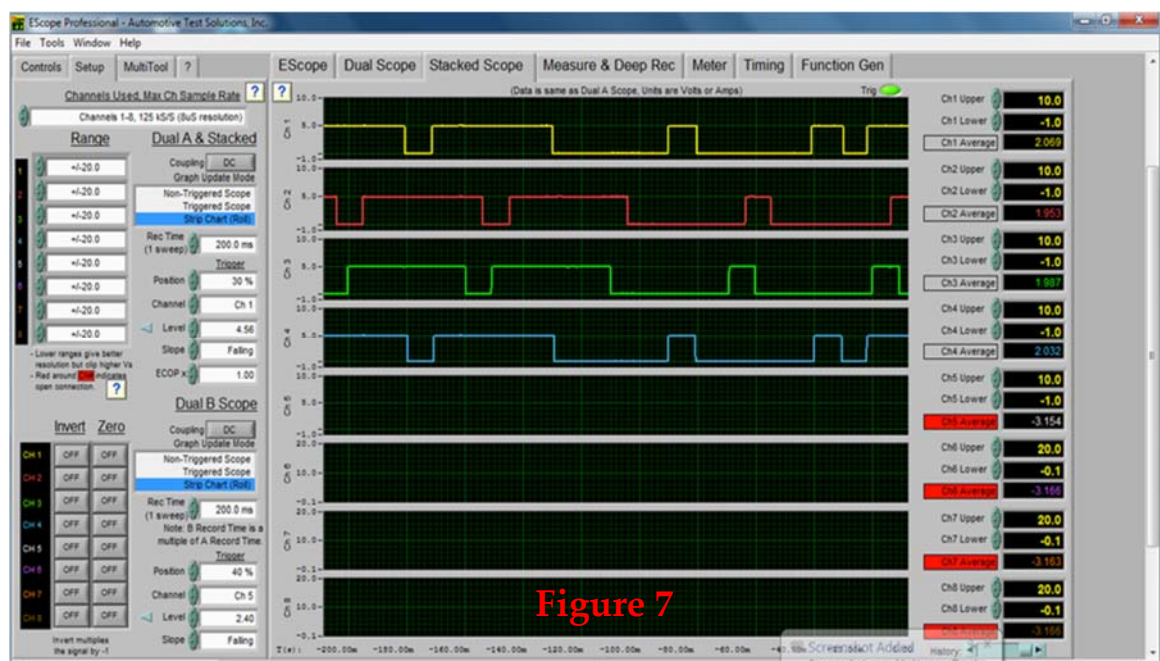


Figure 7

(Con't on page 21)

"How To Tackle Oil Consumption Issues" (con't from p. 20)

After the vehicle was repaired, the Traverse owner dropped by saying that the engine was running great, but the steering did not feel right. He said he called the dealership and was told he needed struts and a wheel alignment. We checked the vehicle out and found that his struts were all good and not leaking, and while it was in we check the camshaft signals (Figure 7 and 8) so we could have a known good signal.

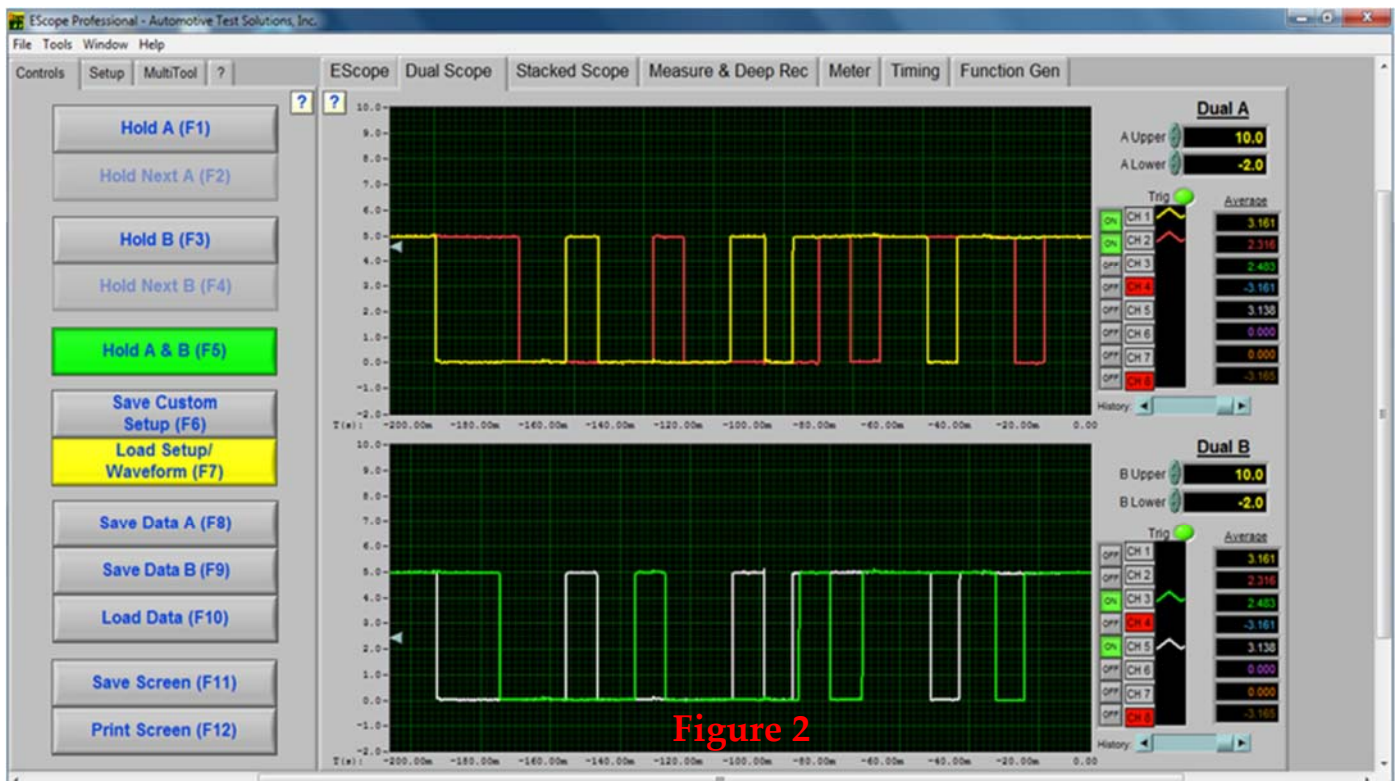


Figure 2

They were correct on one of the two repairs they recommended. It did need a wheel alignment since the engine subframe was taken down and moved from its original position. After the wheel alignment was completed the problem was resolved and the vehicle was back to the way it was designed. Needless to say, the owner was happy that we were able to resolve his steering and suspension problem, along with helping him with the timing chain replacement. The Traverse owner did have one concern about the dealership even though they completed all the work for free. He wondered why the dealer told him that he needed struts and a wheel alignment when there was nothing wrong with the struts.

(Con't on page 24)



THE LATEST TOOLS FOR AUTOMOTIVE SERVICE AND REPAIR

Built by technicians, for technicians



REMOVE SLUDGE, ETHANOL AND WATER AND REDUCE OIL VAPORS THAT CAUSE VALVE DEPOSITS.

Quickly breaks down and removes all sludge, varnish and deposits, and holds them in suspension until they are drained. Eliminates ethanol-related fuel issues with exclusive HydroBond™ Technology.

400-1206 6Di Maintenance Kit
400-6000 Engine Oil Cleaner
400-6220 Engine Treatment
400-2001 Fuel System Cleaner



NEXT GENERATION LEAK DETECTION FOR FORCED INDUCTION GASOLINE AND DIESEL ENGINES.

Cool Smoke® HP delivers market-leading ease of use, reliability and leak detection.

600-0160 Cool Smoke HP with Turbo Adapter Kit
600-0160NA Cool Smoke HP without adapters



QUICKLY AND EFFICIENTLY RECOVER, RECYCLE, AND RECHARGE AUTOMOTIVE A/C SYSTEMS.

Patented unique, fast and complete refrigerant changeover system with 7" color touch-screen control, patented oilless compressor and motor-controlled ball valves and 1-2-5 warranty.

FX154A SAE J2788H R-134a
FX1234 SAE J2843 R-1234yf
FX3030 SAE J3030 R-134a & R-1234yf



Proud sponsor of

Technicians' Service Training
13 Cape Place
Middletown, New York, 10941
845.628.4828 • 845.628.4899 • www.testtraining.org

 **cps** Automotive



FACTS ABOUT TPMS

- Before TPMS, flat tires and blow outs contributed to more than 78,000 crashes, 10,000 injuries and 400 fatalities each year
- During normal driving conditions, tires lose 1.5 psi each month
- TPMS reduces the chances of having one or more severely under inflated tires by 56%

1 Scan VIN barcode for Make, Model, Year selection



2 Trigger each sensor to read all sensor information



3 Relearn TPMS with step-by-step instructions



DIAGNOSE TPMS WITH AN ATEQ TPMS TOOL - KEEP YOUR CUSTOMERS SAFE ON THE ROAD

ateq-tpms.com



“How To Tackle Oil Consumption Issues” (con’t from p. 21)

On the owner’s behalf, I contacted the dealership and asked if GM could reimburse him for the wheel alignment since it should have been performed along with the timing chain job in my opinion. The last I heard the dealer is considering the issue and will get back to me.

A Honda Next

Our next oil related problem vehicle is a 2010 Honda CR-V with a 2.4L engine and 70K miles on it. We have been servicing this vehicle since it was new and changed the oil using 0W-20 SN/GF5 rated full synthetic Idemitsu then Eneos Japanese’s oil before switching to Pennzoil Platinum oil with no change of oil consumption. We researched the oil consumption problem for our customer since the engine was using a quart of oil in less than 600 miles. This CR-V is not driven hard since a mom uses it for normal transportation around town and on the highway. We explained to the customer that the local Honda dealer would perform an engine oil consumption test on the motor to see if it passes or fails the test. The first step the dealer will perform will be to drain the oil and change the filter, using the OEM-required oil and filter. If it fails the consumption test, Honda will refund the cost of the oil and filter change along with replacing the pistons, piston rings and possibly the complete motor for free if it less than 8 years old or has been driven less than 150k miles (whatever comes first).


We made sure before telling her about this information that we checked and replaced the PCV components to rule out any problem in the PCV system, along with making sure there were no existing oil leaks. The CR-V owner is busy being a mom and has not yet had Honda perform the test. You can’t fix what you can’t control.

BMW In The Bay

BMW’s have an oil consumption problem mostly due to ***(Con’t on page 25)***

“How To Tackle Oil Consumption Issues” (con’t from p. 24)

poor engine breathing issues. It is recommended that you use a manometer along with checking the specification for the BMW engine your working on to check if it is in specification. We normally encounter many BMWs, as well as Benz owners, that buy more car than they can afford and they don’t follow the proper maintenance schedules or the recommend services. The problem with BMW, Benz and Audi are neglected breather systems but it is not totally the fault of their owners. As I stated, most of the owners that come to our shop can’t really afford to maintain the vehicle properly, so they look for the cheapest way out. Going the cheap way causes the Euro owners to spend a lot more bucks on their vehicles as a result of their poor maintenance.

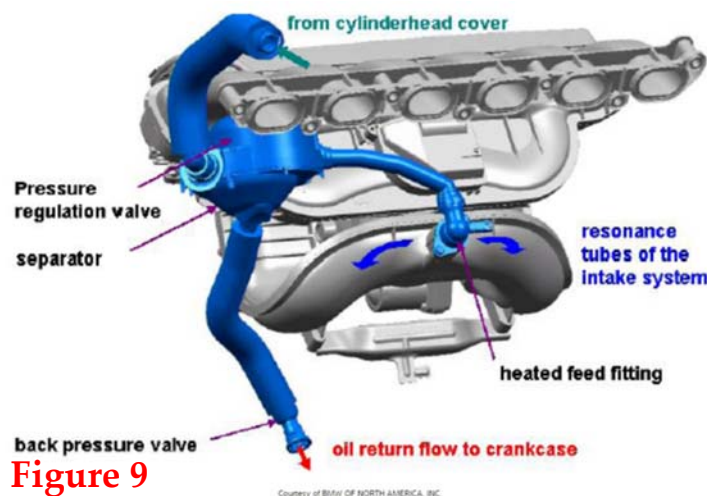

One popular vehicle in our area is the BMW 328xi E90 with 3.0L N52K package that often has oil issues. The oil issues are mostly from leaks due to the breather/PCV system (Figure 9 & 10) that is not properly flowing oil vapors. We use our digital manometer with a special oil cap (Figure 11 on page 26) from AGA Tools since most of the Euro engines we work on do not have oil dip sticks. Using the BMW recommendation for the engine of 33 mBar with a 10 percent variation, but not more than 5 mBar difference, will reveal a problem or not. More than a few BMW owners have come in with issues of poor running, performance, MIL illuminated or oil leaking that they could not get resolved on their neglected Beemers.

(Con’t on page 26)

"How To Tackle Oil Consumption Issues" (con't from p. 25)

After performing a breather test that fails, we recommend the replacement of the breather components with the BMW cold weather package that includes the pressure regulator valve, separator, backpressure valve and hoses. We ask the vehicle owner to return in 1000 miles so we can check for leaks and see if the engine is consuming oil. BMW oil requirements are a 5w30 ACEA approved oil only. One quart of oil in 750 miles is what BMW states as acceptable. Wow, that bucks!

In ending this article, I want to remind you to always check the oil level in every vehicle that comes into your shop, making sure it at the proper level. If the oil is found to be low, adjust the level until it's full or change it if it's overdue for service. Always check the OE requirements of oil and the specification that is recommended along with a good quality filter. Don't forget to check engine TSBs that may include oil information and oil consumption test procedures.

Happy motoring!

***Article By
"G" Truglia***

***TST Founder and President
ASE World Class Triple Master
L1, L3, F1, A9, X1 C1, Technician***



Figure 11

eSCOPE ELITE4™

Electronic Lab Scope 4 Channel



eSCOPE ELITE4
with Surface Pro 4 Tablet
(ESL3000)



eSCOPE ELITE4 (ESL3100)



eSCOPE ELITE4
Handle Articulation

eSCOPE ELITE4 - 4 Channel scope


- ▶ **Capture All Data:** ATS' unique circular buffer system does not drop data.
- ▶ **Ultra Sharp Waveforms:** No need for filters that can mask data. ATS designs our scopes so the signal is accurate and clean.
- ▶ **Dual Time Base:** This allows two different frequencies to be displayed on one screen with two different scope displays, simultaneously.
- ▶ **Pull Down Circuit:** A Controlled pulse that sinks power from vehicle circuit to ground. Control circuits like ignition coils, fuel injectors and solenoids.
- ▶ **TTL Output:** Sends a 0-5v square wave signal out of scope. Turn on devices such as ignition coil drivers, test vehicle's circuits, and test vehicle's circuits for loading.
- ▶ **Automatic Test Lead Connection Detection:** This unique feature allows you to know the scope lead has a good connection. "Red" = Bad connection. "Green" = Good connection. It's that easy!
- ▶ **Patented Overlay Technology:** ATS' unique programming overlays an engine cycle grid over your waveforms.
- ▶ **Automatic voltage attenuator:** Just change the voltage setting and the scope does the rest.
- ▶ **Deep Record Function:** No time, voltage, or trigger setup needed.
- ▶ **Pressure Transducers:** Drives four pressure transducers at once.

Finally...

A Cleaning Solution That Actually Works!

1.6L Turbo Mini Cooper at 83,000 miles

Before Cleaning

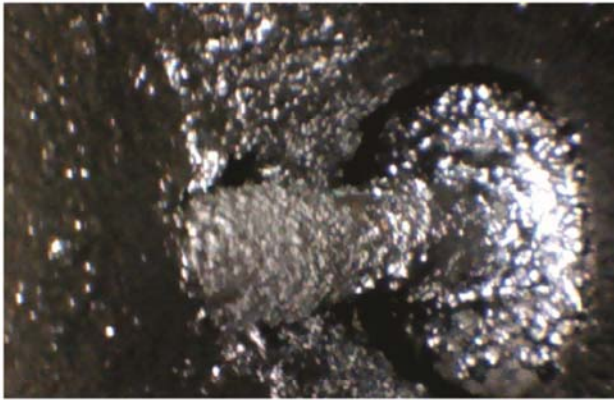

After Cleaning



3C Intelligent Induction Cleaner

Patent Pending

3C Intelligent Induction Cleaner (Patent Pending) removes heavy carbon deposits from the internal combustion engine's induction system in just 20 minutes.

Air Assist Injection Nozzle (Patent Pending) delivers chemical in small droplets that are suspended and carried to the carbon deposits by the engine's air flow. This air assisted nozzle is superior to any other nozzle available for carbon removal.

Chemical Layering (Patent Pending) removes more carbon because it alters the application of chemical mixtures between chemical A and Chemical B in on/off cycles, then washes the induction system with Chemical C.

Micro-Burst Injection Technology (Patent Pending) delivers the maximum amount of chemical during the cleaning process while still allowing the engine to run well.

3C Chemical A, 3C Chemical B, 3C Chemical C (Patent Pending) are laboratory proven to remove more carbon weight from different carbon types than any other commercially available induction carbon cleaning chemical, while having a low HMIS health rating of (2).